


P82.86-5361-09

- | | | | | | |
|---|-------------|---|-----------------------|-------|---|
| 1 | Covering | 5 | Bolt | 8 | Electrical connector (for code (864) Rear entertainment system) |
| 2 | Bolts | 6 | Bolts | A40/3 | COMAND control unit |
| 3 | Cover frame | 7 | Electrical connectors | | |
| 4 | Cover | | | | |

	Remove/install		
	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1.1 	Temporarily store basic data of COMAND control unit (A40/3) in STAR DIAGNOSIS Connect STAR DIAGNOSIS and read out fault memory	When replacing COMAND control unit (A40/3). i Installation: Copy temporarily stored basic data to new COMAND control unit (A40/3). STAR DIAGNOSIS diagnosis system	AD00.00-P-2000-04A *WH58.30-Z-1048-13A
2	Switch off ignition and remove transmitter key or Keyless Go start/stop button from EIS [EZS] control unit	i Keyless Go start/stop button only for vehicles with code (889) Keyless Go.	
3	Unclip panel (1)		*115589035900
4	Unscrew bolts (2)	Rechargeable drill / screwdriver	*WH58.30-Z-1007-20A
5	Open cover frame (3) and fold covers (4) of bolts (5) inwards and up		
6	Undo bolts (5) and close covers (4)	Rechargeable drill / screwdriver	*WH58.30-Z-1007-20A
7	Close and remove cover frame (3)		
8	Undo bolts (6) and remove COMAND control unit (A40/3), until the electrical connectors (7) are accessible	Rechargeable drill / screwdriver i The bolts (6) remain on the COMAND control unit (A40/3). Installation: Carefully slide in COMAND control unit (A40/3) to avoid damage to electrical lines and fiber optic cables.	*WH58.30-Z-1007-20A
9	Disconnect electrical connectors (7) Notes on avoiding damage to fiber optical cables during repair work		AH82.60-P-0001-05AK
10.1	Disconnect electrical plug (8)	For vehicles with code (864) Rear entertainment system	
11	Remove COMAND control unit (A40/3)		
12	Install in the reverse order		

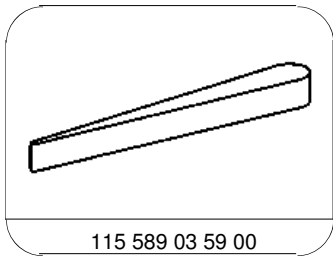

Long wedge

Commercially available tools

Number	Designation
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car 6511 1801 00
WH58.30-Z-1007-20A	Cordless drill/driver