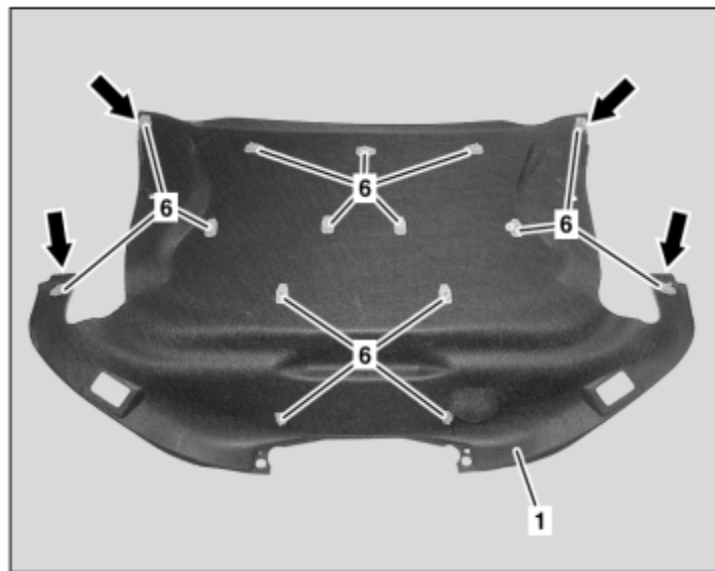
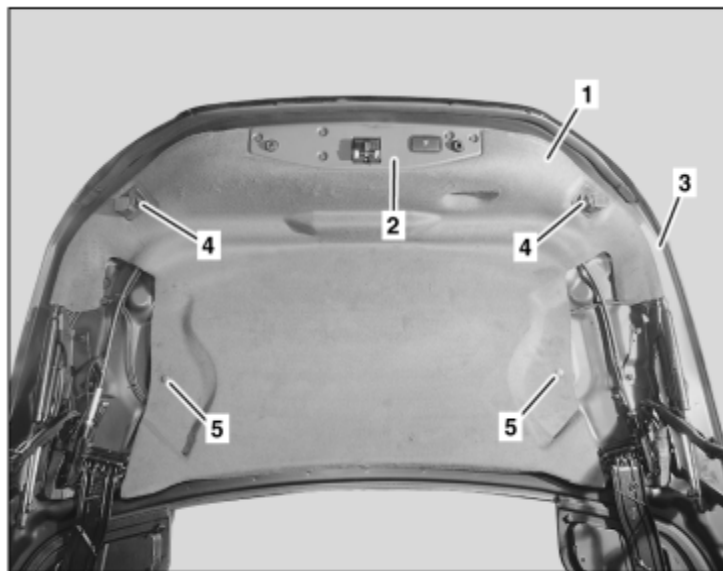


AR68.30-P-8150R	Remove/install trunk lid paneling	20.12.05
-----------------	-----------------------------------	----------

MODEL 230.4





P68.30-3262-08

- 1 Paneling
- 2 Cover
- 3 Trunk lid

- 4 Closing wedge
- 5 Expansion clip
- 6 Clip

Modification notes

7.11.05	Move trunk lid to assembly position eliminated		
---------	--	--	--

	Remove/install		
 Danger!	Risk of injury caused by moving parts that can pinch, crush or, in extreme cases even sever extremities.	No parts of the body or limbs should be within the operating range of the mechanism when components are in motion.	AS00.00-Z-0009-01A

1	Completely open Vario roof		
2	Remove cover (2) from trunk lid (3)	i Installation: Replace damaged expansion clips.	
3	Remove closing wedges (4) from trunk lid (3)	Nm	BA88.50-P-1015-01A
4	Remove expansion clips (5)	i Installation: Replace damaged expansion clips (5).	
5	Unclip paneling (1) from trunk lid (3) starting at outer clips (6) (arrows) and remove.	! Position mounting wedge directly to corresponding clip (6) to unclip, to prevent damaging paneling (1).	
		i Installation: Replace damaged clips (6).	
		!	110 589 03 59 00
6	Install in the reverse order		
7	Check trunk lid adjustment (3), correct if necessary	Vehicles up to vehicle ident. end no. 063909	AR88.50-P-5200R
		Vehicles as of vehicle ident. end no. 063910	AR88.50-P-5200RA

Nm Trunk lid

Number	Designation	Model 230
BA88.50-P-1015-01A	Bolt, closing wedge to trunk lid	Nm 8



110 589 03 59 00

Mounting wedge